

Date: Thursday, 6/7/2007 3:33:39 PM  
 User: Kim Johnston

## Process Sheet

26

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350 SKIDTUBE ASSEMBLY RH
Job Number	: 32869		
Estimate Number	: 10265		
P.O. Number	:	Part Number	: D350636012
This Issue	: 6/7/2007	S.O. No. :	
Prsht Rev.	: NC	Drawing Number	: D2750 UNDER REVIEW CB
First Issue	: / /	Project Number	: N/A
Previous Run	: 32642	Drawing Revision	: D
		Material	:
Written By	:	Due Date	: 6/30/2007
Checked & Approved By	:	Qty:	1 Um: Each
Comment	: Est Rev: I 02.09.25 Rearranged procedure steps KJ : Est Rev: J 06-03-29 As per Rev D EC : Est Rev: J 06-07.13 As per dsi9343 EC		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 002

07.06.08

2.0	D26003BENT	Extrusion Bent
-----	------------	----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2600-3-Bent	Extrusion (Bent)	

3.0	D2744	Fwd Cap
-----	-------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: \_\_\_\_\_

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 &amp; DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 &amp; DT8863 and cut

REFERENCE ONLY

NO. 119

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay, Elliott  
Joint Welding Procedure tig  
Part number and Job number 0 D550 636 CR / 632870

TEST WELDS REQUIRED

BASE METAL Aluminum WELDING PROCESS tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position		Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>	
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into \_\_\_\_\_ Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 01-07-19 Qualifier Pat Duvall





UNDER REVIEW

07.07.05 CB  
OK CB

**D2750-041/-042 ASSEMBLY**  
**D2750-041 SHOWN (D2750-042 OPPOSITE)**

INSTALL NAS1330S3KB166  
INSERTS (4 PLACES)  
AFTER FINISH

BOND D2739 WEB INTO D2750-1 (OR D2750-2)  
OUTER TUBE WITH NON-STRUCTURAL  
SIKAFLEX-241 ADHESIVE PER DART QSI 015.  
NOTE: ENSURE THAT HOLES LINE UP.

SEE DET. P  
SEE DET. N  
D3488-041  
(OR D3488-042)

BLACK ANTI-SKID


D2741

SEE DET. Q


DETAIL G

INSTALL NAS1330S3KB166  
WEARSHOE INSERTS (38 PLACES)  
AFTER FINISH


RELEASED  
06.02.07 #

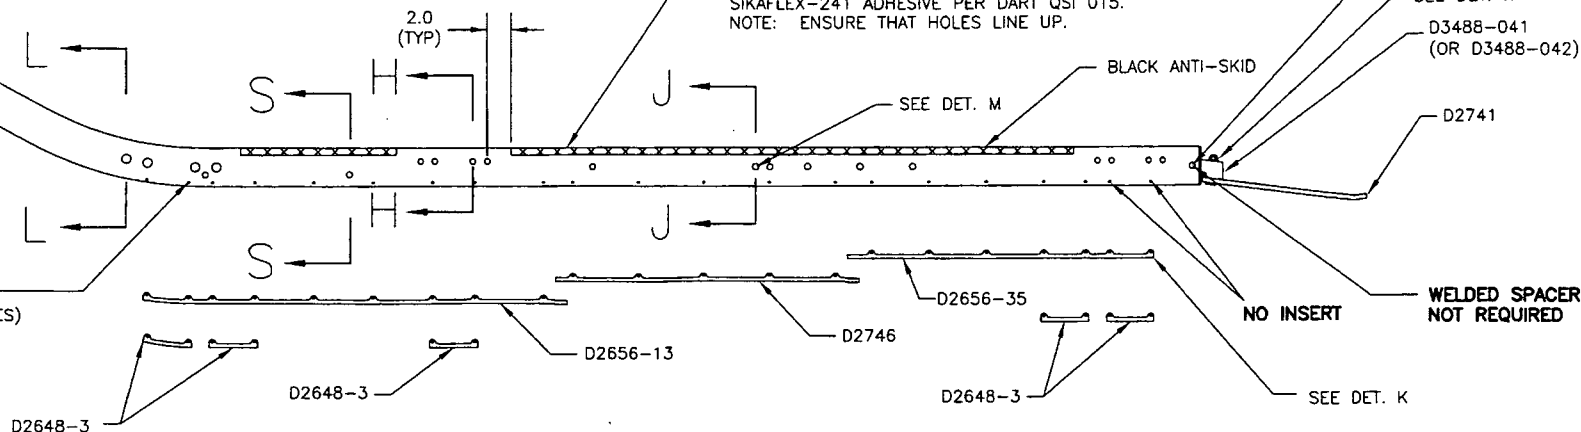

DETAIL G

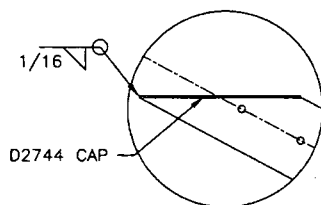


SECTION H-H

 

**WELDING INSTRUCTIONS**


1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2743 SPACER
3. WELD INTO PLACE
4. GRIND FLUSH
5. DRILL OUT SPACER TO Ø0.484
6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

DETAIL M

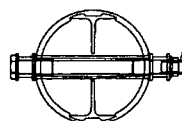


NOTE: INSTALL WASHER BETWEEN  
SKIDTUBE AND BUSHING

SECTION L-L

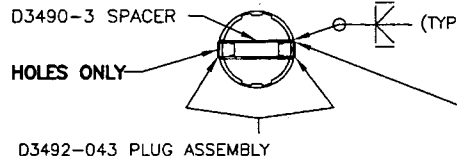


SECTION S-S

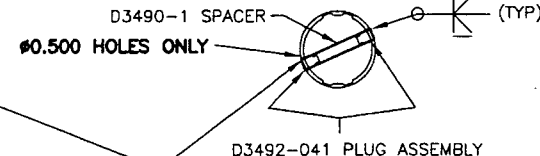


**WELDING INSTRUCTIONS**

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO Ø0.750 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS


DETAIL N

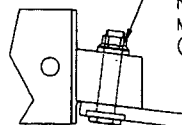


DETAIL K

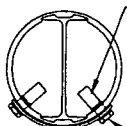

DETAIL P

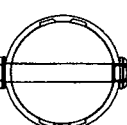

DETAIL Q

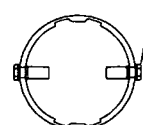

NO. 22869

SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
FOR A MENDMENT  
WITHOUT NOTICE  
WORK ORDER

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	#	APPROVED	#	DRAWING NO. D2750
DATE	06.01.05	TITLE	350 SKIDTUBE ASSEMBLY	REV. D SHEET 4 OF 5 SCALE 1:20

~~SS-warp plates~~

ok  
CB

RELEASED  
06-02-07

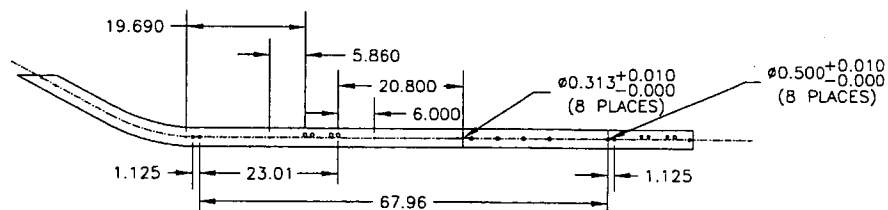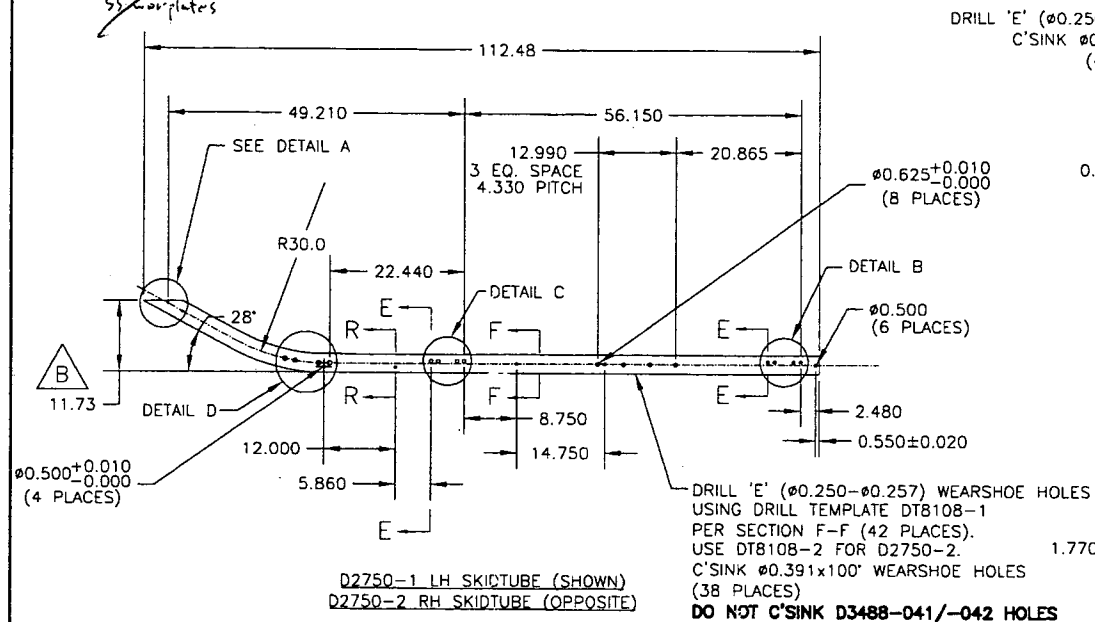

D2750-3 LH SKIDTUBE (SHOWN)  
D2750-4 RH SKIDTUBE (OPPOSITE)

D2750-3/-4 AND D2750-1/-2 HAVE THE SAME SADDLE AND  
GROUND HANDLING HOLES

UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

SHOP COPY  
RETURN TO  
ENGINEERING

SHOP COPY

RETURN TO

ENGINEERING

CONTROLLED


ECT TO AMEN

WITHOUT NO

WORK ORD


NO. 10

DRILL 'E' (Ø0.250-Ø0.257)  
C'SINK Ø0.291X100'  
(4 PLACES)

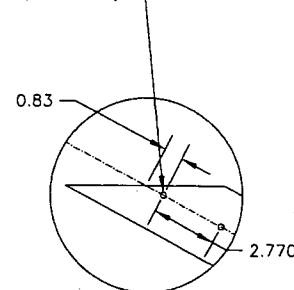


DETAIL A

0.500<sup>+0.010</sup><sub>-0.000</sub>  
(8 PLACES)

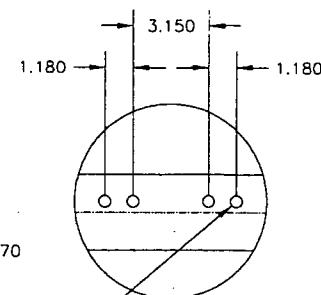


DETAIL B

(8 PLACES)

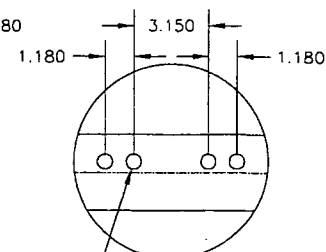


DETAIL C

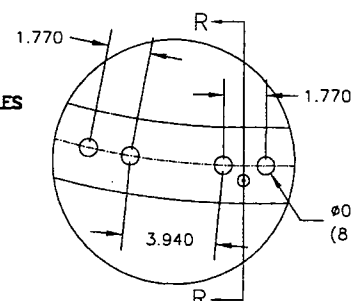


DETAIL D


(ALL DIMENSIONS ARE  
STRAIGHT LINE DIMENSIONS)

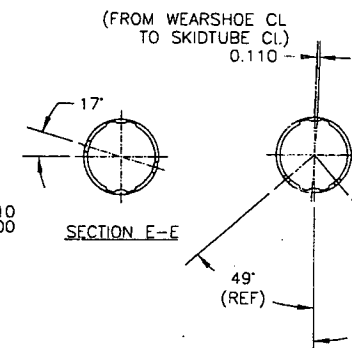


SECTION E-E

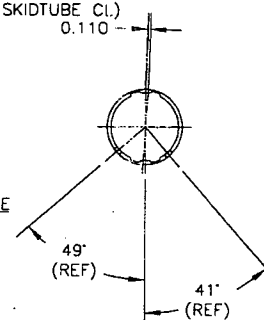

SECTION F-F

 

SECTION R-R

COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	DESIGN	PH	DRAWN BY	PH	 DART AEROSPACE USA, INC. PORT HADLOCK, MA		
	CHECKED	#	APPROVED	#		DRAWING NO.	REV. D
	DATE	06.01.05				D2750	SHEET 3 OF 5
						TITLE	SCALE
					350 SKIDTUBE ASSEMBLY	1:20	



DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. 0 SHEET 2 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

UNDER REVIEW

07 02 05 (b)  
SS wearplates

OK  
CB

RELEASED  
06.02.07

GENERAL NOTES:

1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.150 \pm 0.010$  IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.15 \pm 0.030$  IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:  
MINIMUM YIELD TENSILE STRENGTH = 35 ksi  
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:  
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.  
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ( $\emptyset 0.250$ -  $\emptyset 0.257$ ) FOR WEARSHOE INSERTS. C'SINK  $\emptyset 0.391 \times 100^\circ$  AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES

RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
NOTICE  
WORK ORDER  
NO. 32869

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. D SHEET 1 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY SCALE NTS	
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157	

RELEASED  
06.02.07 *PH*

UNDER REVIEW

07.02.05 CB

*add gaskets  
change to SS wearplates*

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
5	5	5	5	D2648-3	WEARPAD
1	1	1	1	D2656-13	WEARSHOE
1	1	1	1	D2656-35	WEARSHOE
1	1	1	1	D2746	WEARSHOE
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
2	2	2	2	AN8C21A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
4	4	4	4	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
3	3	3	3	MS21083C8	NUT
42	42	42	42	NAS1330S3KB166	INSERT
46	46	46	46	NAS1515H3L	WASHER
12	12	12	12	NAS1515H8L	WASHER

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO 32869

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 6/7/2007 3:33:40 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

48.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
WASHER

1326001

SP

49.0

D35321

spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
spacer

1327894

SP 7/18/05

50.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

5/20/17

51.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1  
Package as per PPP D350-636-012

DEV: E

07/08/17

SP

52.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07.08.20

Job Completion



11 07.08.17

332849

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 6/7/2007 3:33:40 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Coat all exposed fasteners with "LPS Procyon"

batch: M104251

W 04-08-15

CL

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

EC 07/08/16

42.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade

Batch: B32583

SP

44.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M104093

SP

45.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch: M104625

SP

46.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M105107

SP

47.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M104955

7/5/10 SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 6/7/2007 3:33:40 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M104093

*eh*

36.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M108693

*eh*

37.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M104025

*eh*

38.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

WASHER

Batch: M104603

*eh*

39.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

WASHER

Batch: M104922

*eh*

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch: M105085

3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M104989

EXP DATE: 08-01

*eh*

*04-08-15*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D3492043

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B30569 *JK*

29.0

AN3C5A

Bolt



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Bolt

Batch: M1104603 *JK*

30.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M1103693 *JK*

31.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M1103668 *JK*

32.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M1103964 *JK*

33.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M1102671 *JK*

34.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

washer

Batch: M1105143 *JK*

07-08-15 *JK*



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Wearpad

Batch: B 31695

JA

22.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B 32653

JA

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B 30554

JA

24.0

D2746

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch: B 30141

JA

25.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch: B 31697

JA

26.0

D3488042

BLADE FITTING ASSEMBLY, RH



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch: B 32233

JA

27.0

D3492041

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B 32590

JA

07-08-15

0

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750

) R 7-7-30

10-Debur holes

14.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/08/13/

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Er 07/08/01

16.0

POWDER COATING

POWDER COATING



M105068



(1R)

Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

MRK 07/08/08  
PRESS WASH BR 07-08-08

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

FR 07/07/15 ①

18.0

NAS1330S3KB166

INSERT



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

INSERT

Batch: M105039

21

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts as per dwg D2750

07-08-15

①

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

Er 07/08/15 (41)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

D34901

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

*B32293*

*BE 07-07-20*

11.0

D34903

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch:

*B33074*

*BE 07-07-20*

12.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch:

*B331696*

*BE 07-07-20*

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side)  
as per dwg D2750.

2-Open up holes of Detail D to 0.750" (total of 4 holes per side)  
as per dwg D2750.

3-Open float holes to .500" (4 per Side)

4-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on sheet 4)

5-Deburr and blow out all chips from inside of tube

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

*M104732*

exp. date:

*8-1-1*

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004  
(welding instructions on sheet 4)

A/R

Aluminum Rod

batch:

*M104907 BE 07-07-20*

8-Grind welds flush as per Dwg D2750

*R 7-7-09*

*R 7-7-19*

*R 7-7-30*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 32869

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

as per dwg D2750.

4-Drill pilot holes for Detail B using DT8330

5-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750.

6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" \*\*\*Make sure that wearplate holes are on bottom of tube\*\*\*\*\*

7-Open up holes of Detail A to 0.250" (total of 2 holes per side)

8- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

9-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004  
A/R Aluminum Rod *M102421 BE 07-06-19*

10-Grind welds flush as per Dwg D2750 *Pw 07-06-19*

11-Countersink Detail A as per dwg D2750. *Pw 07-06-19*

5.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

*BE 07/06/20*

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*BE 07/07/17*

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

*R 7-7-18*

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BE 07-07-19*

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

*B33062*

*R 7-7-19*



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 6/7/2007 3:33:39 PM  
 User: Kim Johnston

## Process Sheet

26

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY RH  
 Job Number : 32869  
 Estimate Number : 10265  
 P.O. Number : N/A Part Number : D350636012  
 This Issue : 6/7/2007 S.O. No. : N/A Drawing Number : D2750 UNDER REVIEW  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D  
 Previous Run : 32642 Material : N/A  
 Written By : Due Date : 6/30/2007 Qty: 1 Um: Each  
 Checked & Approved By :  
 Comment : Est Rev: 02-09-25 Rearranged procedure steps KJ  
 Est Rev: J 06-03-29 As per Rev D EC  
 Est Rev: J 06-07-13 As per dsi9343 EC

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 002

Per Attached

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2600-3-Bent Extrusion (Bent) B32448

B32448 R 7-6-18

3.0 D2744 Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch: B229784 BE 07-06-19

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2- Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut

R 7-6-18

R 7-6-19